



IIB05-1-S

## INSTALLATION BULLETIN

**DATE:** January 26, 2005

**SUBJECT:** Home Standby Air-cooled Generators - Serial Numbers 3789827 and Below

**CAUTION:** The 12" braided flex fuel line supplied with the subject generators can leak if improperly installed.

The flex fuel line must not be bent beyond 10 degrees during the installation and upon completion of installation. Replace the fuel line if bent or if ferrules are damaged. The replacement fuel line is Part # 0D3031A. Ensure the installation of the new fuel line eliminates bends.

**CAUTION:** Turn off gas supply before replacing flex fuel line and check for leaks after installation of new flex fuel line.


**Figure 1**

Split Ferrule On 12" Braided Flex Fuel Line



**Figure 2**

Proper Installation Of New Flex Fuel Line Without Bends

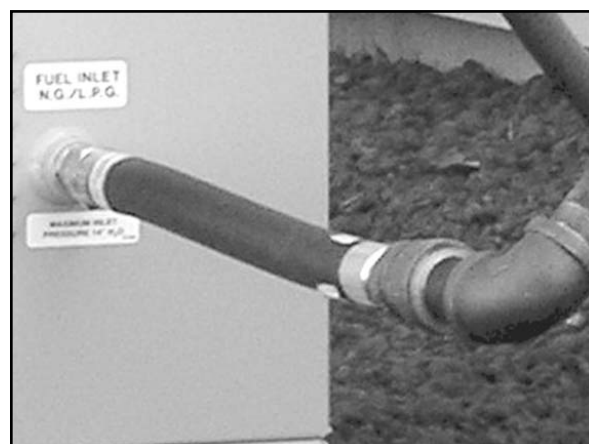

**WARRANTY:** Generac will pay appropriate parts and labor to install the replacement fuel line Part # 0D3031A on subject models. Any additional charges to correct bending are the responsibility of the installer.